



# **iJRASET**

International Journal For Research in  
Applied Science and Engineering Technology



---

# **INTERNATIONAL JOURNAL FOR RESEARCH**

IN APPLIED SCIENCE & ENGINEERING TECHNOLOGY

---

**Volume:** 13      **Issue:** I      **Month of publication:** January 2025

**DOI:** <https://doi.org/10.22214/ijraset.2025.66220>

**[www.ijraset.com](http://www.ijraset.com)**

**Call:** ☎ 08813907089

**E-mail ID:** [ijraset@gmail.com](mailto:ijraset@gmail.com)

# Repair & Rehabilitation of Rigid Pavement: A Case Study

Satendra Rai<sup>1</sup>, Prof R.K. Yadav<sup>2</sup>

<sup>1</sup>ME Student, <sup>2</sup>Associate professor, Department of Civil Engineering, Jabalpur Engineering College, MP

**Abstract:** Transportation infrastructure is crucial for a nation's development. This paper aims to investigate the various types of rigid pavement failures and to identify the most effective maintenance strategies to address these issues on the Jabalpur-Mandla highway, formerly designated as NH 30 (previously NH 12A). An examination of the roadway between the 3 km to 40 km markers reveals a range of pavement failures, including longitudinal cracks, raveling, rutting, and shear failure. The predominant causes of these rigid pavement failures include excessive loads, inadequate drainage systems, and significant rainfall. Such pavement deteriorations not only hinder the daily lives of residents but also escalate maintenance costs. This study outlines repair techniques for several prevalent crack types that may occur during the construction phase, in the post-construction period, and throughout the pavement's service life. The present studies identifies that the classifications of common defects and distresses in rigid pavements with their source along with the way to correct it with associated maintenance procedure.

**Keywords:** Rigid pavements, Highway Failures, Causes, Repairs, Maintenance

## I. INTRODUCTION

National Highway (NH 30) starts from the Sitarganj in Uttarakhand to Ibrahimpatnam, Vijayawada in Andhra Pradesh. The total length of this highway is 1984.30 km. It passes from Jabalpur runs via Barela, Udaipur, Bijadandi, Mandla, Madhopur, Anjanika and Bichhiya in Madhya Pradesh. Its connect NH-34, NH-45 and NH-543. The road also passes through Kanha National Park, which is the Famous National park in India. Development of Surface Cracks in rigid pavement are due to temperature difference, late joint cutting, and defective curing of rigid pavement. The cracks will allow water / mud /debris going into the cracks and widens them further. Shrinkage is another common reason for cracking. As concrete hardens and dries it shrinks. The chemical reaction, which causes concrete to go from the liquid or plastic state (or a solid state), requires water. This chemical reaction, or hydration, continues to occur for days and weeks after you pour the concrete. Longitudinal cracks, transverse cracks, diagonal crack, pumping, faulting, spalling, shrinkage, punch out, deterioration of joint load transfer system, linear cracking, durability cracking, corner break, alkali-aggregate reaction, pop-outs and blow-ups are some of failure of rigid pavements. Crack filling, Crack sealing, Stitching, Diamond grinding, Dowel bar retrofitting, Joint repair, Partial-depth repair and Full-depth repairs are the most common techniques used for restoration of rigid pavements .

## II. LITERATURE REVIEW

Suja A.C.A. Marliyas M.M (2016) -. Presented failure types as identified with the help of literature survey and the exerted reasons on the failures were studied. Altogether 10 types of various failures were identified in randomly selected all rigid pavements, and 5 major types of failures were focused and stated in this paper. Polished aggregate was the most common problem among the identified failures followed by scaling and transverse cracking. The reasons and solutions were given to those problems by observing those failures and discussing with the responsible road owning authorities. Some solutions were given in order to prevent failures of newly constructed rigid pavement in future. Gurpreet Mains, Er. Neeraj Kumar, Dr. Rakesh Gupta (2019) – Evaluated different types of defects e.g. scaling of cement concrete, shrinkage cracks, joint spalling, warping cracks, pumping. & evaluate causes of defects affecting failures. Dr. B. Prasad, K.Nagateja, Sulakshana Natuva, Bathini Jayanth (2024) -. Studied defects and their causes is the reduction in serviceability brought on by the development of various types of deterioration on the flexible pavement, such as cracks, surface defects, disintegration, etc. The breakdown of bituminous pavement can have numerous causes.

### III. OBJECTIVE

The objectives of studying rigid pavement failure aim to categorize and identify different types of rigid pavement failures, such as cracking, faulting, spalling, and joint deterioration, to better understand their characteristics and to develop effective maintenance and rehabilitation strategies that can extend the life of rigid pavements and reduce the frequency and severity of failures.

#### A. Factor Affecting & Causes of Pavement Failure

- 1) Poor quality of material used in the Pavement construction.
- 2) Defects in quality control and construction method.
- 3) Improper drainage system.
- 4) Movement of heavy load vehicles or increase in load repetition because of increase in traffic volume.
- 5) Improper compaction of pavement layer during early stages of construction.
- 6) Factors such as rainfall, increase in water table etc

#### B. Classification of Structural Cracks

The structural cracks are classified according to crack width are as follows :-

- 1) *Narrow Cracks* – If the width of crack is 0.5mm it is considered as narrow crack. It is assumed that there is full aggregates interlock and full load transfer is taking place within the slab at the crack.
- 2) *Medium Crack* – If the width of crack is 0.5 -1.5mm it is considered as medium crack. It is assumed that there is partial aggregates interlock and partial load transfer is taking place within the slab at the crack. These types of cracks permit of water.
- 3) *Wide Crack* – If the width of the crack is greater than 1.5 mm it is considered as wide crack. It is assumed that there is no aggregates interlock and no load transfer is taking place within the slab at the crack. These types of cracks permit of water and fine particles.

#### C. Type of Maintenance

Type of maintenance for rigid pavements are as follows:

- 1) *Routine Maintenance or preventive pavement maintenance*: This treatment to pavement functioning properly. Routine maintenance includes crack sealing, pothole repair, joint sealing in the rigid pavement.
- 2) *Programmed Maintenance*: It restore the deterioration to its original condition. Programmed Maintenance includes cross-stitching, partial depth repairs, full depth and diamond grinding to remove faults.
- 3) *Rehabilitation and Strengthening*: Increase design life for future expected traffic loads. It includes diamond grooving for restoring surface texture, retrofitting of dowel bars, slab stabilization, reconstruction or application of an overlay.
- 4) *Emergency Repairs*: these repairs are quick, temporary fixe to potholes and cracks that are done to keep driver safe.

#### D. Types of failure

Types of Failures, their causes and remedies in Rigid Pavement are presented in table 1.

TABLE 1- types of failure , their causes and remedies

S.No	Types of Failures	Description & Causes	Remedies
1.	Plastic Shrinkage Cracking	These are hairline cracks that are less than 2m in length. They do not cross the entire slab. The setting and curing process of the concrete slab results in such cracks.  Drying shrinkage stresses in surface Poor curing Hot wind condition	Protect the concrete from drying wind Moisture subgrades and forms to prevent absorption Damped dry aggregates that are absorptive Reduce the temperature of the concrete
2.	Edge Cracking	Curved shaped cracks or continuous cracks that intersect the pavement edge and are located within 0.5m of the pavement edge, adjacent to shoulder.	Improve drainage and clear nearby trees and shrubs

		Poor load transfer Dowel bar restrained Curling slabs	
3.	Corner Break	Corner break is a diagonal crack in a rigid pavement that intersects a joint near the corner of the slab. High corner stresses Loss of support Curling and warping stresses Effective load transfer at the joints	Full-depth patch
4.	Transverse Cracking	Transverse cracking in rigid pavement is a type of crack that runs perpendicular to the pavement center line direction. Excessive drying shrinkage stresses Delays or interruption of concrete placing for more than 30 minutes Excessive overloading Sudden thermal and moisture gradient stress changes	Crack Sealing Crack Injection Overlay of concrete surface
5.	Diagonal Crack	A diagonal crack in a rigid pavement can be caused by a number of factors including: Shear stress, Flexure at mid span Excessive drying shrinkage stresses Excessive thermal and moisture gradient stresses Excessive joint spacing Excessive over loading	Epoxy Injection Epoxy resin Application Epoxy mortar
6.	Longitudinal Crack or Linear Cracking	Longitudinal cracks in rigid pavement run parallel to the pavement centerline and can be straight or in the shape of an arc. They can occur in a lane about 3 to 5 cm from the pavement edge. Excessive drying shrinkage stresses Excessive joint spacing Sudden thermal and moisture gradient changes Settlement of sub grade also settlement of slab Different sub-base or sub grade types having different modulus of elasticity	Crack sealing, sealcoating and resurfacing overlay
7.	Fatigue Cracking or Alligator Cracking	Fatigue cracking or crocodile cracking is type of damage that occurs in concrete pavement when it repeatedly subjected to traffic loading and environmental conditions Traffic loading to cracking Environmental conditions factors like moisture and temperature change Inadequate support the base or sub base of the pavement	Remove the cracked pavement area then dig out and replace the area of poor subgrade and improve the drainage & patch over the repaired subgrade Full depth repair
8.	Ravelling Scaling	Loss of fine aggregates from mix of cement paste laitance from the surface through abrasion that may or may not have been previously cracked. Segregation at surface Crazing or fine alligator cracks	Cutting & Micro concreting of pavement. Partial depth cracking



		Unsound aggregates Weak concrete Excessive Abrasion	
9.	Polished surface or Glazing or Smooth Surface	Polished aggregate is a pavement defect that occurs when the aggregate surface is worn down by traffic. It can be identified by looking at the aggregate that is above the asphalt, which may be very small or have no rough particles to provide skid resistance. Movement of traffic at an early age Wear and tear under high volumes of traffic particularly under wet or not cleaned surface Soft mineral aggregates	Hot mix asphalt: Apply a skid-resistant slurry seal or bituminous surface treatment like seal coat or chip seal or overlay. Diamond grinding or overlay
10.	Spalling at Cracks or Joints	Excessive compressive stress causes deterioration in the joints or crack. This may be related to joint infiltration or the growth of pavement that are caused by the reactive aggregates.. Dynamic traffic loads at slab ends, mechanical damage Weak concrete or poorly compacted Failure or defects of dowel load transfer system Joints intersection	Spalling width greater than about 75 mm from the crack face may indicated possible spalling at the joint bottom and repaired by full-depth patch

#### IV. METHODOLOGY

Two Lane with paved shoulders for rehabilitation and up-gradation of Jabalpur-Mandla Section from Design Chainage is Km. 3+200 to km 85+400 to Km of NH-12A (New NH-30) in the state of Madhya Pradesh under NHDP-IV. A survey of 37 km is done the Chainage Km. 3+200 to km 40+300 for determining the various types of failure that are present in pavement and their maintenance procedure to overcome it.

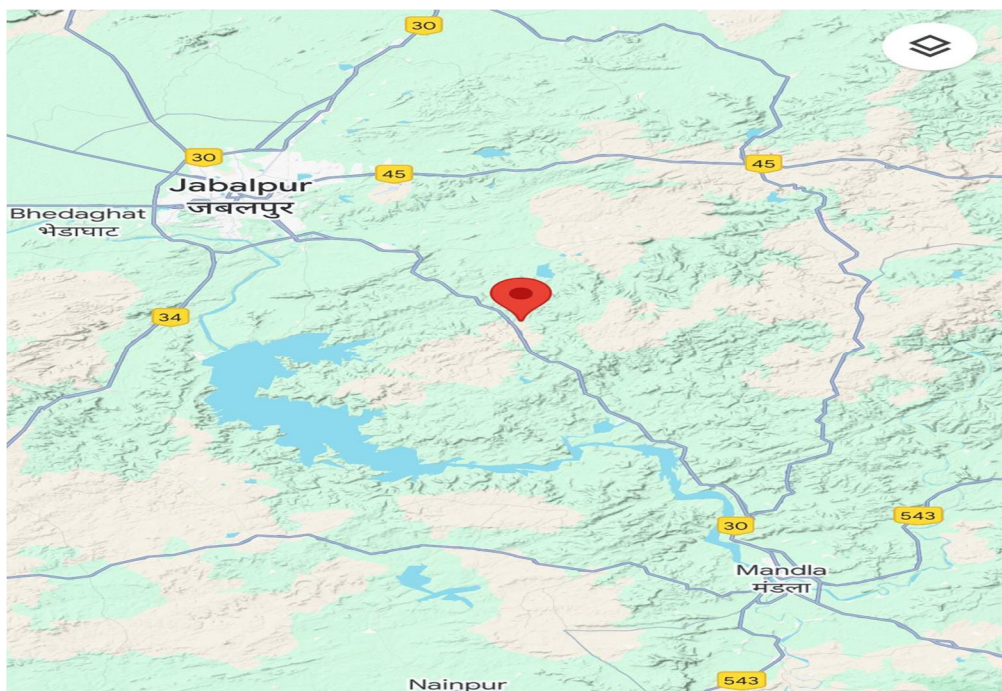


Fig 1. Map of NH 30 Jabalpur to Mandla

Location and types of cracks & other serious defects in rigid pavement Jabalpur to Mandla NH 30 is 2 Lane rigid pavement from distance 3 km to 40 km Barela to Narayanganj run along via Barela, Kalgodi, Dobhi, Udaipur, kudamaili, Bijadandi, Kalpi, Tikariya, Narayanganj in Madhya Pradesh. The various defects found in the pavement and their probable remedies are summarized in table 2.

TABLE 2 Distress observed &amp; remedies measure

S.N o.	Location Mark	Chainage	Length	Near Location around Defect	Types of Cracks	Remedies
1	L1	3+200 to 3+300	100m	Barela	Joint Spalling	Full Depth Repairing
2	L2	3+800 to 4+000	200m	Sharda Mandir	Longitudinal Crack, Plastic Shrinkage Crack	Cross Stitching Epoxy grouting
3	L3	5+000 to 5+100	100m	Ghat End	Plastic Shrinkage Crack	Epoxy grouting
4	L4	6+700 to 6+800	100m	Kalgodi	Longitudinal Crack, Plastic Shrinkage Crack	Cross Stitching Epoxy grouting
5	L5	7+200 to 7+300	100m	La Belle Restaurant	Diagonal of Crack	Cross Stitching
6	L6	9+000 to 9+100	100m	Dobhi Location 1	Transverse Crack, Reveling of Surface	Cross Stitching
7	L7	10+200 to 10+300	100m	Dobhi Location 2	Diagonal of Crack , Corner Break, Joint Spalling	Cross Stitching, Full Depth Repairing
8	L8	11+300 to 11+400	100m	Baiga Tola	Diagonal of Crack, Pot hole	Cross Stitching
9	L9	12+000 to 12+100	100m	Udaipur	Multiple Structural Crack, Joint Separation	Full Depth Repairing
10	L10	13+000 to 13+050	50m	Chauki	Transverse Crack	Cross Stitching, Overlay
11	L11	14+300 to 14+400	100m	Govt Primary School, Moiyana	Diagonal of Crack, Joint Spalling, Corner Break	Full Depth Repairing, Cross Stitching, Overlay
12	L12	18+700 to 18+800	100m	Kachwaha Hotel	Longitudinal Crack	Cross Stitching
13	L13	20+400 to 20+500	100m	Forest Place	Transverse Crack	Cross Stitching Full
14	L14	22+600 to 22+700	100m	Magradha Road	Longitudinal Crack, Transverse Crack	Cross Stitching Full
15	L15	25+000 to 25+150	150m	Bijadandi	Longitudinal Crack, Corner Break, Joint Spalling	Cross Stitching Full Depth Repairing
16	L16	28+500 to 28+600	100m	Dhanwahi	Multiple Structural Crack, Pop-Out, Polished Surface	Full Depth Repairing , Epoxy Mortar
17	L17	30+200 to 30+300	100m	Ballar Baba Bus Stand	Longitudinal Crack, Corner Break	Cross Stitching
18	L18	33+000 to 33+100	100m	Kalpi Niwas Road	Diagonal of Crack, Longitudinal Crack	Cross Stitching

19	L19	37+100 to 37+150	50m	Kudamaili Bhawal	Corner Break, Joint Separation	Cross Stitching
20	L20	37+600 to 37+700	100m	Boriya	Corner Break, Longitudinal Crack	Cross Stitching
21	L21	37+900 to 37+950	50m	Tikariya	Plastic Shrinkage crack, Polished Surface	Epoxy grouting, Epoxy Mortar
22	L22	40+200 to 40+300	100m	Narayanganj	Diagonal of Crack, Corner Break	Cross Stitching

Distress observed in site from Jabalpur to Mandla NH-30 some selected photographs are as under:



Plastic Shrinkage Cracks




Longitudinal Cracks



Corner Breaks



Transverse Cracks

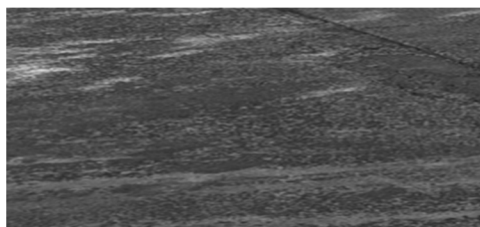

Reveling Scaling



Multiple Structural Cracks



Loss of surface Texture, polished surface



Joint separation



Spalling at cracks

Fig.2 Distress observed at site



## V. RESULTS AND ANALYSIS

All the maintenance processes are sorted in the maintenance categories of various form of failures the data obtained from study area of observed chainage Km. 3+200 to km 40+300

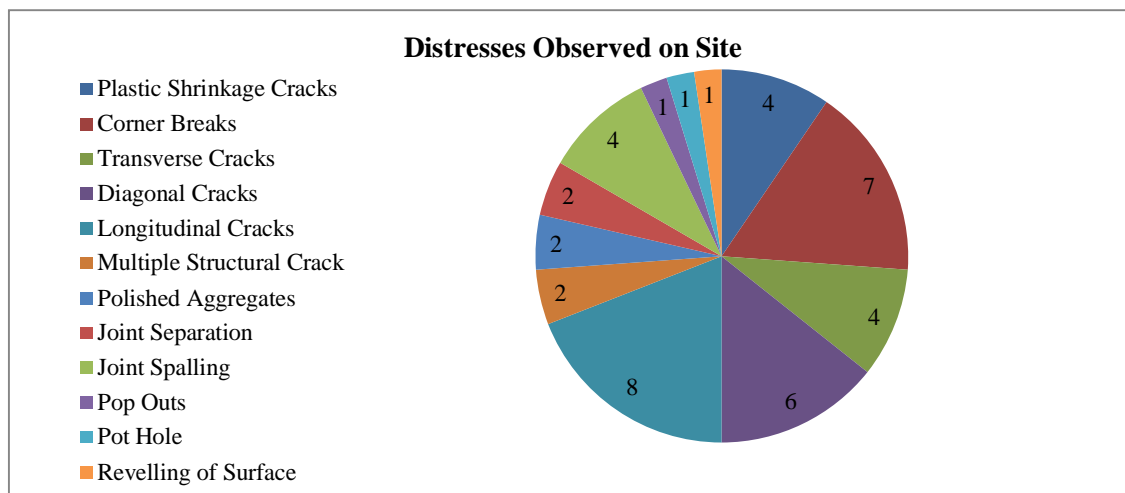


Fig. 3 Number of distress

Hence maximum number of crack is longitudinal crack, corner break, joint spalling and minimum number of crack is pop out & pot hole. Overall this study to observed cross stitching with epoxy fill in the joint, some place of this pavement full depth repaired treatment is done & hot mix asphalt as overlay applied to surface treatment

## VI. REPAIR & RESTORATION OF RIGID PAVEMENTS

Types of Techniques to Repair Defects:

### A. Crack filling

It is the process of filling crack filler into non-working cracks to substantially reduce the intrusion of incompressible material and the infiltration of moisture in the pavement. Usually cracks less than 2 mm and are non-working require crack filling.

Low viscosity epoxy and polymer- modified asphalt are used as crack filler.



Fig.4 Filling of joints using bitumen sealant

### B. Stitching

It is a repair technique to maintain aggregate interlock at the point of cracking and to provide added reinforcement and strength to the pavement. Stitching is carried out for strengthening longitudinal cracks in slabs. Stitching is also adopted to alleviate the problems of omission of tie bars during construction, to tie roadway lanes and centerline longitudinal joints of pavements.

There are three types of stitching used; cross-stitching, slot-stitching, and U-bar stitching.



### C. Partial depth repairs

Partial depth repairs can be used for repair of Pot holes, Pop outs, Corner cracking, edge cracking, joint spalling type of surface defect which may be repair in rigid pavements.

The process involves the following steps:

- 1) Identification & marking of repair part
- 2) Removal of affected concrete
- 3) Cleaning & preparation of patch
- 4) Application of primer or bonding agent
- 5) Placing of concrete & finishing surface
- 6) Curing of repair patch
- 7) Allowance of traffic

This technique is used to repair joint and crack deterioration and surface distress, popouts and potholes.

### D. Flexible overlay

For location L-10 chainage to L-11 chainage flexible overlay over rigid pavement for increase the life of pavement



Fig. 5 Overlays at L-10 location

### E. Full depth repairs FDR

Full-depth repair, also known as a whole section substitution, is a method for fixing a full-depth crack in a rigid pavement. This technique used to restore the structural integrity and rideability of rigid pavement, and to extend its service life. It used to repair isolated areas of deterioration, such as cracks, corner breaks, and deteriorated joints.

The process involves the following steps:

- 1) Identification & marking of repair part
- 2) Removal of affected concrete
- 3) Cleaning & preparation of patch
- 4) Application of primer or bonding agent
- 5) Placing of concrete & finishing surface
- 6) Curing of repair patch
- 7) Allowance of traffic

This technique is used to repair full depth cracks, corner crack and joint deterioration & repair punchouts

### 5. Diamond grinding

Diamond grinding is a pavement preservation technique that uses diamond-tipped saw blades to remove hardened concrete from a pavement's surface. It's often used on concrete pavements, but can also be used on asphalt concrete pavements.

Diamond grinding can improve -

- 1) Improve ride quality: Remove bumps and scallops that can make the pavement uncomfortable to drive on
- 2) Improve surface texture: Create a longitudinal, continuous texture with ridges and corrugations
- 3) Increase friction: Reduce the chance of hydroplaning
- 4) Reduce accident rates: Diamond-ground surfaces have been shown to have up to 60% fewer accidents than non-ground surfaces
- 5) This technique is used as specialized technique used to extend serviceability, improve ride and skid resistance

## VII. CONCLUSION & RECOMMENDATION

- 1) Jabalpur – Mandla highway NH 30 observation between 3 km to 40 km maximum type of crack were found as longitudinal crack, corner crack ,multiple structure failure the suggested reame measure as Full Depth Repair , Stitching , Crack filling by epoxy.
- 2) At some location as summarized in table 2 bituminous overlay is also suggested.
- 3) Many type of cracks such as uncontrolled transverse full depth cracks, plastic shrinkage cracks, full depth cracks near slab, cracks over dowel bars etc. have been observed on the concrete road . The probable solution is also suggested.
- 4) The sealing of all kind of cracks in rigid pavement must be done with approved material to avoid the further development. At some location full panel replacement is required, it should be done along with sub-base, to avoid the chances of re-occurrence of cracks.
- 5) This distress is in the form of cracks, revelling, joint spalling settlement etc. are observed & the solution for rehabilitation and repair was suggested.

## REFERENCES

- [1] IRC:SP:83-2018 Guidelines For Maintenance, Repair And Rehabilitation Of Cement Concrete Pavements (First Revision)
- [2] IRC-58-2011 Guidelines for the design of plain jointed rigid pavements for highways.
- [3] S.K. Khanna –C.E.G Justo , book of highway engineering .
- [4] Bhatt, J I, Miller, F M and Kosmatka, S H Innovations in Portland Cement Manufacturing, (SP400) PCA, Skokie, Illinois, 2004.
- [5] Sprinkel, M M 'Very-Early-Strength Latex-Modified Concrete Overlay', Transportation Research Record, No. 1668, 1999, pp.18–23.
- [6] Guide for Selecting and Specifying Materials for Repair of Concrete Surfaces, International Concrete Repair Institute. January 1996
- [7] Guide for Selecting and Specifying Materials for Repair of Concrete Surfaces, International Concrete Repair Institute. January 1996.
- [8] IRC:43 - "Recommended Practice for Plants, Tools and Equipment Required for Construction and Maintenance of Concrete Roads"
- [9] Gurpreet Mains , Er. Neeraj Kumar , Dr. Rakesh Gupta A Review Paper on Evaluation of Rigid Pavement Failures International Journal for Research in Applied Science & Engineering Technology (IJRASET) ISSN: 2321-9653; IC Value: 45.98; SJ Impact Factor: 6.887 Volume 7 Issue IV, Apr 2019
- [10] Raghvendra Katarpawar Vijay Kumar Pandey, Shashikant Srivastava(2021) A Detailed Case Study on Construction and Maintenance of Rigid Pavement International Research Journal of Engineering and Technology (IRJET) e-ISSN: 2395-0056 Volume: 08 Issue: 07 | July 2021
- [11] Suthathip Suanmali, Veeris Ammarapala "Maintenance budget planning: A case study for rigid pavement maintenance system in Thailand" IEEE, June 2010
- [12] Mankar Nikhil C., Prof. Nichat K. P. " Study On All Types Of Failures In Rigid Pavement "International Research Journal of Modernization in Engineering Technology and Science e-ISSN: 2582-5208 /Volume:02/Issue:06/June -2020
- [13] Suja A.C.A. , Marliyas M.M. "Identification of Problems In Rigid Pavements In Ampara District And Proposed Solutions "Research Gate December 2016.
- [14] Dr. B. Prasad , K. Nagateja, Sulakshana Natuva, Bathini Jayanth" Case Study on Pavement Failures & Its Maintenance"



10.22214/IJRASET



45.98



IMPACT FACTOR:  
7.129



IMPACT FACTOR:  
7.429



# INTERNATIONAL JOURNAL FOR RESEARCH

IN APPLIED SCIENCE & ENGINEERING TECHNOLOGY

Call : 08813907089  (24\*7 Support on Whatsapp)